



ELECTRONICS TESTING CENTER, TAIWAN  
 ADDRESS: NO.5 HSIN HO 2 RD.,AN PIN INDUSTRIAL PARK,  
 TAINAN , TAIWAN  
 TEL:06-2925787 FAX:06-2650302  
<http://www.etc.org.tw>



Ind. Ser. No. : 13-03-NEF-041

Issue Date : 2013 / 3 / 26

## TEST REPORT

Ind. Ser. No. : 13-03-NEF-041  
 Applicant : GlacialTech Inc  
 Address : 9Fl.,No352,Sec.2,Jung Shan Rd. Jung He Dist, New Taipei  
 City 235,Taiwan  
 Products : LED Driver  
 Main Model : GP-LS150PH-210  
 Model : Series Model : GP-LSYYYPH-XXXZZZZ  
 (Model difference Consult ANNEX A)  
 Date of Receipt : 2013 / 3 / 20  
 Test specification : IEC60529 Edition 2.1 2001-02  
 Electronics Testing Center, Taiwan – Southern Taiwan  
 Inspection Site : Industry Service Department  
 (TAF Certification No:1161)  
 Testing Item : IP67  
 Test condition : See the following sheets  
 Test result : PASS



The test results relate only to the items tested.

The report shall not be reproduced except in full without the written approval of Electronics Testing Center, Taiwan.

This inspection has carried out to the best of our knowledge and ability, and our responsibility is limited to the exercise of reasonable care, this certification is not intended to believe the sellers from their contractual obligations.

Tested by : Yu Bin Qiu 2013.3.26  
 Yu Bin Qiu  
 Southern Taiwan Industry  
 Service Department

Approved by : Yi Hong Lin 2013.3.26  
 Yi Hong Lin  
 Southern Taiwan Industry  
 Service Department



# TEST REPORT

Ind. Ser. No. : 13-03-NEF-041

\*\*\*\*\*

## Testing Item: IP67

### Testing Conditions :

(1) IP6X :

- (1) Maximum depression of 2kPa (20mbar ) °
- (2) The test shall be continued for a period of 8 hours °

(2) IPX7 :

- (1)Put the testing sample under water 1 m.
- (2)The duration of the test is 30 min.

### Testing Result :

Request/Experiment	Results	Remark
Accordance with IEC60529 13.1,13.4and 13.6 test. The protection is satisfactory if no deposit of dust is observable inside the enclosure at the end of the test.	There is no trace of dust inside.	IP6X
After testing in accordance with appropriate requirements of IEC60529 14.1,14.2.7 and 14.3	No ingress of water was found inside.	IPX7



# TEST REPORT

Ind. Ser. No. : 13-03-NEF-041

\*\*\*\*\*

## Utilized testing equipments


	Kind of Instrument	Manufacturer	Model Serial NO.
✓	Thermo-Hygro Recorder Cal. Date:2012/06/14 Recommended Recal Date:2013 / 06 / 13	HAENNI	KRK-501/13491030-001
	Electrical Safety Compliance Analyzer	EXTECH	7452/E992214
	AC 20Kv 200mA	Asis	SYT-20kV200mA/S97-004
	Push And Pull Dynamometer with Linear Scale (0...50N)	PTL	P10.35/5001028
	Push-Pull gauge	ALGOL	NK-300/30954
	Protractor	—	A7028-J ( 0° ~ 90° )
✓	Stop Watch Clock Alarm Cal. Date:2012/09/04 Recommended Recal Date:2013/09/03	CATIGA	CT-500
✓	Test rod,1mm	E.D.&D.	TRP-02
	Test rod,2.5mm	ASIA QTECH	TRP-1/0803
	Test sphere 50mm	ASIA QTECH	TSP-1/0801
	Test finger	PTL	P10.14/5001023/13502009-001
	Test sphere 12.5mm	ASIA QTECH	TSP-2/0802
✓	DUST TEST CHAMBER Cal. Date:2012/04/25 Recommended Recal Date:2013/04/24	PTL	P14.41/5050255
	Drip Box ( IPX1~IPX2 )	PTL	P01.18/5080026
	Oscillating Tube ( IPX3~IPX4 )	PTL	P02.27/5080027
	Hose Nozzle ( IPX5 )	PTL	P03.26/5080028
	Hose Nozzle ( IPX6 )	PTL	P03.28/5080029
✓	Water Butt ( IPX7~8 )	—	—

\*\*\*\*\*

**LED Driver : IP6X Test Photo**



**LED Driver : IPX7 Test Photo**

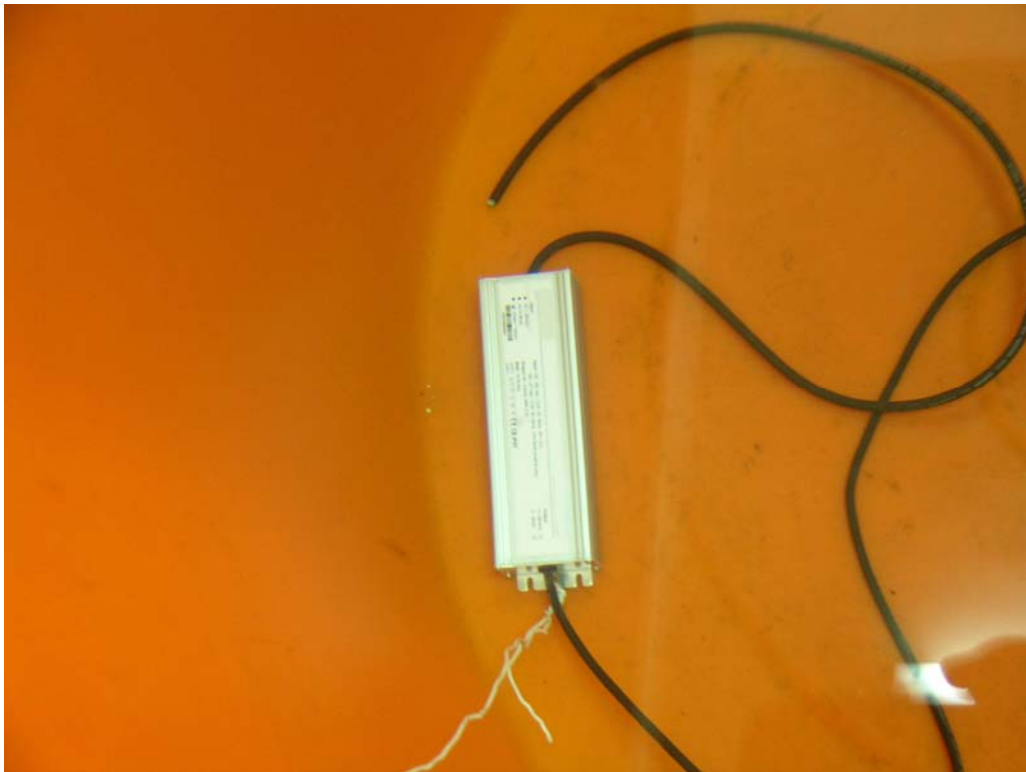

\*\*\*\*\*

## LED Driver : Appearance



## LED Driver : Appearance




\*\*\*\*\*

### LED Driver : Inside



### LED Driver : Inside

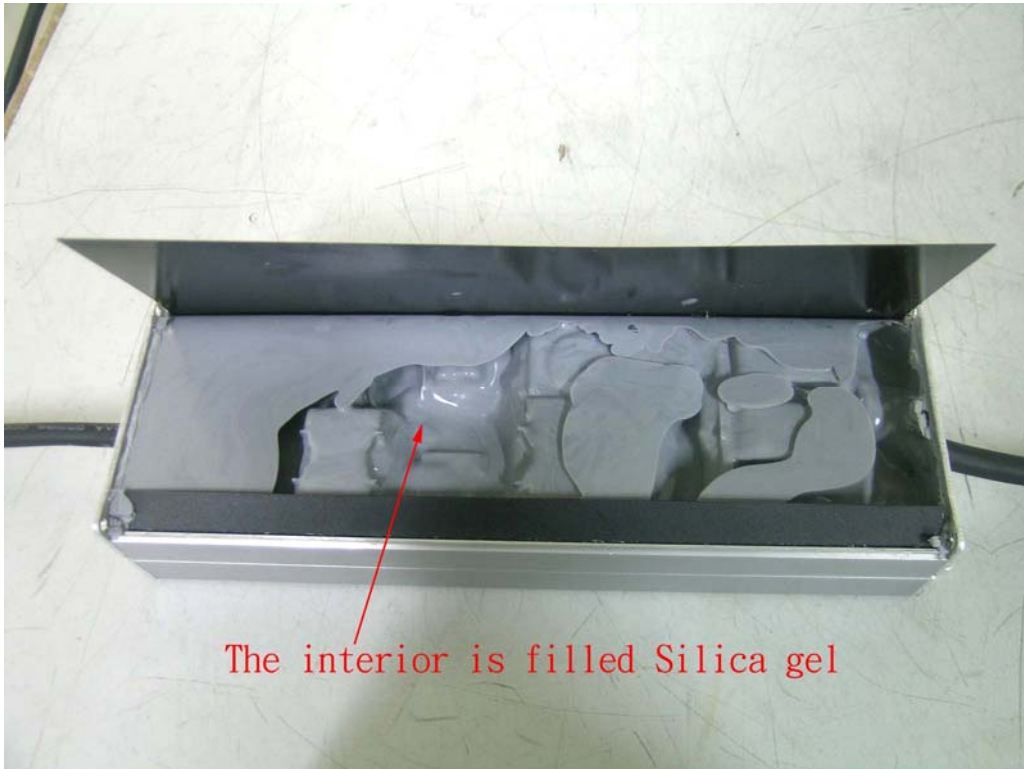

The interior is filled Silica gel



# TEST REPORT

Ind. Ser. No. : 13-03-NEF-041

\*\*\*\*\*

## ANNEX A

**Model : GP-LSYYYYPH-XXXZZZZ    YYY=120,150**

**XXX=086,115,172,227,343,099,107,113,143,210,284,428**

**ZZZZ=maybe any character or number or blank for marketing purpose only**